

## QUIPP SELLS ANOTHER SIX (6) QUIPP PACKMAN PACKAGING SYSTEMS AND GETS READY TO SUPPORT YOUR REDUCTION TO A 48" WEB

Quipp is proud to announce the sale of another six (6) Quipp Packman Packaging Systems.

- **The Fresno Bee**, Fresno, CA purchased two (2) Quipp Packman Systems
- **The Idaho Falls Post Register**, Idaho Falls, ID purchased two (2) Quipp Packman Systems
- **The Daily Sun**, The Villages, FL purchased two (2) Quipp Packman Systems

Quipp is also proud to announce the sale of a major project consisting of floor equipment and conveyors to **The Tampa Tribune** in Tampa, FL, to be installed beginning of 2006.



**QUIPP  
PACKMAN:  
Stack, Wrap,  
Print & Strap  
in one fast,  
reliable  
operation**



To request a Brochure, Product Specifications Sheet, User's List, a VIDEO or a CD on the Quipp PACKMAN e-mail us at [news@quipp.com](mailto:news@quipp.com) or call us at (305) 623-8700 ext 350

The QUIPP PACKMAN design is based on Quipp Stacker & Bottomwrapper technology, developed in over 3,400 stackers and 2,100 bottomwrappers sold since 1983.

Because the QUIPP PACKMAN is based entirely on familiar and proven technology, both operator and maintenance personnel will immediately be comfortable with its operation and care.


## QUIPP GETS READY FOR REDUCTION TO 48" WEB MODIFICATIONS TO QUIPP EQUIPMENT DUE TO CHANGING TO A 48" WEB

Dear Quipp Customer,

If you are currently running 50" web products in your facility, the change in width (1/2") using the 48" web should have little effect on the Quipp equipment you are currently running. There are, however, a few areas where there may be some issues, but nothing that should keep you from producing a newspaper.

### QUIPP TWIN-TRAK BELT CONVEYOR

The corner boxes on the vertical sections of the Quipp Twin-Trak belt conveyor are an area of concern. Basically, there are three narrow belts on the backside of each corner box. These belts help products make the transition from horizontal to vertical or from vertical to horizontal. There is a chance that narrower products can get caught behind one of the outside belts, causing a jam. It is important to note that not all corner boxes will have problems. The position of the paper in relation to the corner box plays a major role in whether you will have a problem or not. There is a good possibility that you will not experience any problems. Quipp has a kit made up to modify the corner boxes if not already done. One kit is required per vertical conveyor. The Part number for the kit is QPN # 1312-30935 and it has a price of US\$2,500.

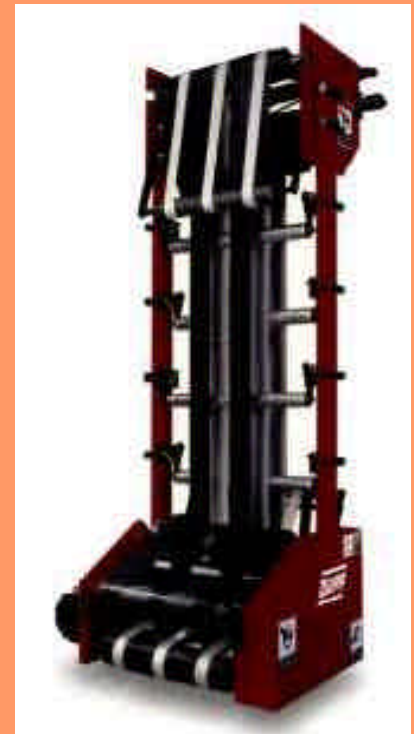

Some Components of Kit 1312-30935

## QUIPP STACKERS

**Quipp Model 50X stackers** should be fine. The spacer on the pusher for the 50" web should work. **Quipp Model 40X stackers** should be fine. The modification you may consider is to install larger spacers on the pushers in the stacker's bucket. If you already have spacers in place to handle the 50" products, you could install spacers that are about ¼" larger than what you currently have in place. Larger spacers will reduce the amount of paper movement in the bucket as each bundle is compensated. Quipp Pusher Spacers Kit – first set US\$800 (each additional set of spacers is US\$400)



Some Components of Kit 3311-30962

**The Quipp Model 35X stackers** will require a modification.

Quipp has developed a kit for this that includes the brackets for the paper guides, the deflectors and new pushers. The kit is QPN# 3411-30992 and it has a price of US\$600.

The **Quipp Model 300 stackers** will also require a modification. Quipp has developed a kit for this that includes the brackets for the paper guides, the deflectors and new pushers. The kit is QPN# 3311-30962 and it has a price of US\$600.

The **Quipp Model 200 stackers** may require additional modification on top of the larger spacers mentioned above. There are paper guides in the stacking section of the stacker. These guides move in and out to help straighten papers as they travel through the stacking section before being dropped into the bucket. These guides on the 200 series stackers do not move in far enough to make contact with the narrower products. Therefore, they cannot align the narrower products as well as they should. Quipp offers a kit that includes new brackets for the paper guides that enable them to move in farther. The kit also includes a new set of spacers for the pushers in the bucket. One kit is required per stacker. The part number for this kit is QPN # 3111-31030 and it has a price of US\$600.

Functionally, your stackers will run fine with the narrower products. **The modifications discussed above will increase the bundle quality and prevent the possibility of decreased production efficiency caused by low quality bundles.**

## QUIPP PALLETIZERS AND QUIPP CART LOADERS

The **Quipp Automatic Palletizer** and **Quipp Automatic Cart Loaders** will have to be addressed on an individual basis.

If you have any concerns about running a 48" web on Quipp equipment other than stated in this document, please contact Quipp for an evaluation of your equipment and product.

**Quipp Phone: (305) 623-8700**

**Quipp Toll-Free: (800) 345-9680**

**info@quipp.com**



Season's Greetings and Best Wishes for a Happy New Year

**QUIPP, INC., THROUGH ITS SUBSIDIARIES,  
QUIPP SYSTEMS, INC. AND NEWSTEC, INC.  
OFFERS A COMPLETE LINE OF RELIABLE  
MAILROOM EQUIPMENT.**

**QUIPP**

**NEWSTEC**

**The Intelligent Post Press Solution**

[www.quipp.com](http://www.quipp.com)

[www.newstec.com](http://www.newstec.com)